Version: xxxxxxxx

Summary Information

Claim

Authorisation Status: Interim Work Provider: **OTHER** XXXXXX Claim Reference: Policy Number: TB/A Other Reference: XXXXXX

Date of Incident: Not Known Able to Authorise Repairs: TBA Repairs Authorised? **TBA** VAT Portion Payable: **TBA**

Repairer:

Estimated Repair Time (Working Days):

Vehicle Details

Vehicle Manufacturer: **BMW**

Model: 3-SERIES 318i

Model Sheet Number: XXXXXX

Engine: 1.5 LTR 100KW Registration Number: XXXXXX

VIN Number: XXXXXX Registration Month: XXXXXX Registration Year: XXXXXX Odometer: 86669 miles Colour: White Paint Code: 300 Build Date: XXXXXX AudaVIN+ Selection Type:

Petrol

No

AIR CON AUTO 2-ZONES WINDSCREEN RAIN SENS

02 VOLUME DAB TUNER

Model Specs

NAVIG SYST BUSINESS

FOG LAMPS CLOTH TRIM

HANDS FREE CONV SYST

ALARM SWITCH ANTI-THEFT ALARM CRUISE CONTROL DIP REAR VIEW MIRROR RR PARK DIST CONTROL 1.5 LTR 100KW 8-GEAR AUTOMATIC

WHEEL BOLT LOCK TYRES 225/50 WR 17 WHEELS 7.5J X 17 ALU INTERIOR TRIM SATIN **EU SPECIFIC**

TYRE W/FLAT RUNNING TYRE PRESSURE SENSOR PREPARE OFF VEHICLE BASECOAT CLEAR

Vehicle Condition

Vehicle Status

Fuel Type: Vehicle Imported:

Pre-Accident Condition: Good Not testable Steering Rim Ply: Not testable Brakes Pedal Travel:

Place of Inspection:

Pre-Accident Damage: Uasual for age Severity of Impact:

Vehicle Status on Inspection:


Date of Inspection:

Assessment Number:	Full Repor	t
Version: xxxxxxxx	Printed:	

Not Available


Tyres Condition: Tread Depth LHF: Tread Depth LHR:

Damage Areas:

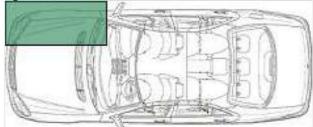

Tread Depth RHF: Tread Depth RHR:

Direction of Impact:

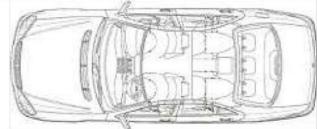

Assessment Number:	Fu	III Report
Version: xxxxxxxx	Printed:	

Addresses

Cost Summary

Total Labour	£1,228.97
Total Paint/Material	£673.29
Total Parts	£849.30
Additional Costs	£673.50
Grand Total Exc VAT:	£3,425.06
20 % VAT:	£685.01
Grand Total Inc VAT:	£4,110.07
Excess:	TBA

Repair Information

LABOUR

Time Basis 12 WU = 1 HR. Price = £80.50/HR

Repair / Guide

Number	Description	Work Units
NO NUMBER	ADD/TIME FOR MAIN WORK	2.0
51 11 656	R + R FRONT BUMPER COVER	9.0
51 11 592	RENEW FRONT BUMPER TRIM	12.0
	(BUMPER TRIM REMOVED)	
63 12 502)	R + R LEFT HEADLAMP	3.0
63 10 502	ADJUST HEADLAMPS	2.0
51 71 540	R + R R/FRT WHEELHOUSE COVER	6.0
NO NUMBER	R + R FRONT BONNET SEAL	1.0
51 41 503	R + R RIGHT FRONT DOOR TRIM	4.0
51 21 829)	R + R RIGHT FRONT WINDOW INNER SEAL	2.0
51 16 501)	R + R R/OUTER MIRROR	1.0
51 21 800)	R + R R/OUTER CHANNEL MOULDING	2.0
51 21 640	R + R R/F DOOR LOCK CYLINDER	2.0
51 21 770)	R + R R/FRONT DOOR OUTER HANDLE	1.0
0742	REPAIR R/F WING	36.0*
0336	CHECK FRT UPP BUMPER CARR	1.0*
0340	CHECK FRT UPP IMPACT DAMP	1.0*
0562	CHECK RIGHT HEADLAMP ASSY	1.0*
1000	CHECK Pre Clean	6.0*

1000	00 CHECK Road Test & QC		12.0*		
	Total Work Units		104.0		
	Total Panel / Mechanical Labour	8.67 HRS	£697.67		

NOTE TIME BASIS = 12 WU / HOUR
OPINION TIMES ENTERED HAVE BEEN CONVERTED TO MATCH MANUFACTURERS TIMES

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £80.50/HR

Repair /Guide	Description		
Number			Work Units
283	FRONT BUMPER NEW PART PAINT K1R		12.0
742	R/F WING REPAIR PAINTING <50%		11.0
1482	RIGHT FRONT DOOR SURFACE PAINT		8.0
1566	R/F OUTER HANDLE SURFACE PAINT PLAST.		3.0
	PREPARATION FOR PRE-PAINTING		32.0
	Total Work Units		66.0
	Total Paintwork Labour	6.6 HRS.	£531.30

TERIAL COST - PAINT	
Total Paint Cost	£509.11
Sundry Paint Material	£0.00
Pre-Painting Sundry Materials	£164.18
Total Excluding Pearlescent Uplift	£673.29
Pearlescent Uplift @ 0.0%	£0.00
Total Paint And Material Cost	£673.29

PARTS

Price Valid:

Guide No.	Description	Part Number	Bet.	Price
283	FRONT BUMPER	51 11 7 445 093	0%	£422.06
303	FRT BUMPER AIR GRILL	51 11 7 386 152	0%	£54.43
306	R/BUMPER AIR GRILLE	51 11 7 396 878	0%	£32.65
316	R/F BUMPER INSERT	51 11 7 279 712	0%	£6.22
318	R/F WING MOUNT	51 11 7 255 362	0%	£5.41
431	GRILLE BADGE	51 76 7 288 752	0%	£38.05
527	BONNET FRT GASKET	51 76 7 255 802	0%	£18.10

638	R/F FOG LAMP	63 17 7 248 912	0%	£127.04
646	R/FOG LAMP CARRIER	51 11 7 386 362	0%	£20.94
842	R/F WHEELHOUSE COVER	51 71 7 260 726	0%	£57.59
1662	R/OUT WINDOW MLDG	51 33 7 258 296	0%	£38.09

Sub Total		£820.58
Sundry Parts	(3.5 %)	£28.72
The Mark Medicine Control of the Con	Total Parts	£849.30

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras	Dinti		B - 11	Dulas
	Description		Betterment	Price
	Energy Cost	Specialist	0%	£75.00
	BS10125	Specialist	0%	£35.00
	EPA	Specialist	0%	£25.00
	Method Research	Specialist	0%	£40.00
	Pre Sweep	Specialist	0%	£75.00
	Post Sweep	Specialist	0%	£75.00
	PPE Equipment	Specialist	0%	£12.50
	Wash & Vacuum	Specialist	0%	£37.00
	Vehicle Sanitising	Specialist	0%	£40.00
	CAR CARE KIT	Specialist	0%	£9.00
	KDS Check	Specialist	0%	£250.00
		•	Total Extras	£673.50

Calculation			
Labour			
	Total Panel/Mechanical	£697.67	
	Total Paintwork	£531.30	
Total Labour			£1,228.97
Total Paint/Material Costs			£673.29
Total Parts			£849.30
Additional Costs			
	Cost of Specialist	£673.50	
Total Additional Costs			£673.50
Grand Total Excl VAT			£3,425.06
	VAT @ 20 %		£685.01
Grand Total Incl VAT			£4,110.07
	Excess		ТВА

Printed:

Assessment Notes

No assessment notes entered.







